

KU-KEN- 721

No.TCD- 1379-1-80

Date Sept. 30. 1980

Japan Civil Aviation Bureau

Airworthiness Directive

The undermentioned examinations or modifications are mandatory.

1. Applies to: Mitsubishi Model MU-2B/-10/-15/-20/-25 and -26: S/N
UP to 347 inclusive (except S/N 313 and 321)

2. Compliance required as indicated ;

To prevent heat damage to the aft engine nacelle and adjacent structure caused by combustion of fuel entrapped in the aft engine nacelle, accomplish the following in accordance with the "Instructions" part of Mitsubishi MU-2 Service Bulletin No. 177B dated Sept. 11, 1980 or later JACAB approved revisions within the next 200 hours' time in service after the effective date of this AD, unless already accomplished,

(a) Install Tadpole Tapes (P/N 016A-13380-3) on nacelle tails and, (b) For S/N 005 thru 204, modify the aft nacelle area and wing trailing edge structures.

3. Remarks:

3.1 Effective Date: Oct. 25, 1980

- 3.2 Mitsubishi MU-2 Service Bulletin No. 177 B dated Sept. 11, 1980 or later JCAB approved revisions pertain to this subject.
- 3.3 This AD amends the AD No. TCD-1379-76 issued on Nov. 8, 1976.