

KU-KEN- 386

No.TCD- 772-1-71

Date Sept. 1, 1971

Japan Civil Aviation Bureau

Airworthiness Directive

Revision

The undermentioned examinations or modifications are mandatory.

1. Applies to: Graviner Type 174A Fire Extinguishers installed on NAMC Model YS-11 and -11A Series Airplanes

2. Compliance required as indicated

To detect possible leakage of the fire extinguisher bottle, accomplish the following inspection within four days after the effective date of this AD, unless already accomplished within the last one month, and thereafter at intervals not to exceed one month from the last inspection.

- (a) Weigh the fire extinguisher. If its weight is found to be less than the indicated quantity on the operating head by 1 oz, the bottle should be replaced with the serviceable one.
- (b) Check the operating head and the brazed area between the operating head and the container for leakage using soap solvent or equivalent after cleaning the area. If the leakage is found, the bottle should be replaced with the serviceable one.

3. Remarks

- (a) This AD partially revises TCD-772-71
- (b) Effective date of TCD-772-71; August 9, 1971
Effective date of this Revision; September 4, 1971
- (c) NAMC Service Bulletin No. A26-26 dated August 10, 1971
Pertains to this subject.